Minebea Power Semiconductor Device Inc.

# Six-input Type Single Chip Inverter IC Application Note [Rev. 1]

Тур	es
200V AC system	ECN30624
	ECN30625

Minebea Power Semiconductor Device Inc.
Design Development Division

- Contents - 1. Outline	3
1.1 Single Chip Inverter IC Outline	
1.2 System Configuration	
1.3 Block Diagram of IC	
2. Content of Specifications	
3. Specifications	
3.1 IC Types	
3.2 Pin Assignments	
3.3 Functions of Pins	
3.4 Markings	
3.5 Functions and Operational Precautions	14
3.5.1 Protection Function	14
3.5.2 New Bootstrap	20
3.5.3 Power On/Off Sequence	20
3.5.4 VCB Power Supply	20
3.5.5 Back EMF Detection (Back electromotive force detection)	21
3.5.6 Internal Filter Circuit	21
3.5.7 Derating	21
3.6 Handling	22
3.6.1 Mounting	22
3.6.2 Precautions for Mounting Heat Sink	24
4. Recommended Circuit	26
4.1 External Components	26
4.2 Other External Components	27
5. Failure Examples (Assumptions)	28
5.1 Inverter IC Destruction by External Surge Inputted to Vdc and Vcc Lines (Case 1)	28
5.2 Inverter IC Destruction by External Surge Inputted to Vdc and Vcc Lines (Case 2)	28
5.3 Inverter IC Destruction by External Surge Inputted to Vdc and Vcc Lines (Case 3)	28
5.4 Inverter IC Destruction by External Surge Inputted to Vdc and Vcc Lines (Case 4)	28
5.5 Inverter IC Destruction by External Surge Inputted to Vcc Line	29
5.6 Inverter IC Destruction by Vcc Line Noise	29
5.7 Inverter IC Destruction by Noise at Vdc Power Supply Power-on	30
5.8 Inverter IC Destruction by Inspection Machine Relay Noise	30
5.9 Motor Failure (Missing Phase Output)	
6. Precautions for Use	31
6.1 Countermeasures against Electrostatic Discharge (ESD)	31
6.2 Storage Conditions (applied to: ECN30624F, ECN30624R, ECN30625F, ECN30625R, ECN30625S)	31
6.3 Maximum Ratings	31
6.4 Derating Design	31
6.5 Safe Design	31
6.6 Application	31
7. Notes Regarding this Document	32

#### 1. Outline

## 1.1 Single Chip Inverter IC Outline

Our single chip inverter ICs are monolithic ICs integrating various constituent devices and circuits required for inverter control on a single chip. They are for driving motors, suited for variable speed control of three-phase induction motors and brushless DC motors. The advantage of downsizing by the use of a single chip structure can be used to reduce the control board in size, which can be incorporated in a motor.

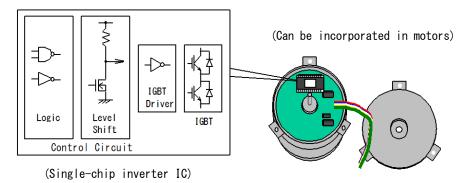


FIGURE 1.1.1 Image of Motor with Built-in Control Board

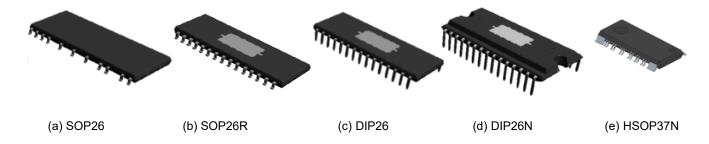


FIGURE 1.1.2 Types and Packages of IC

## 1.2 System Configuration

An inverter is a device that converts DC currents into AC. It can be used to drive motors with efficient variable-speed control. Figure 1.2.1 shows the example of basic system configuration of an inverter IC. To drive the three-phase motor with an inverter, six IGBTs and free wheel diodes are used as output stages. The IC consists of an IGBT driving power circuit, level shift circuit, a logic circuit and other components. Our Inverter ICs can directly receive high voltage supplied from rectifying commercial AC power, because they have high dielectric strength. This obviates the need of a step-down circuit, thus inhibiting efficiency cuts induced by voltage conversion.

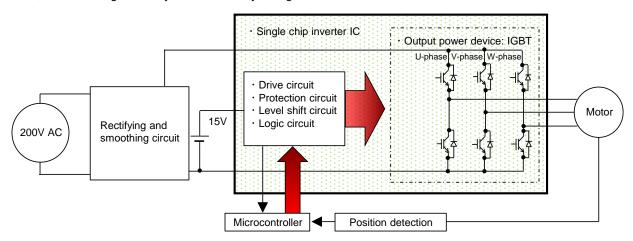


FIGURE 1.2.1 Example of Basic System Configuration

## 1.3 Block Diagram of IC

Figure 1.3.1 shows a block diagram.

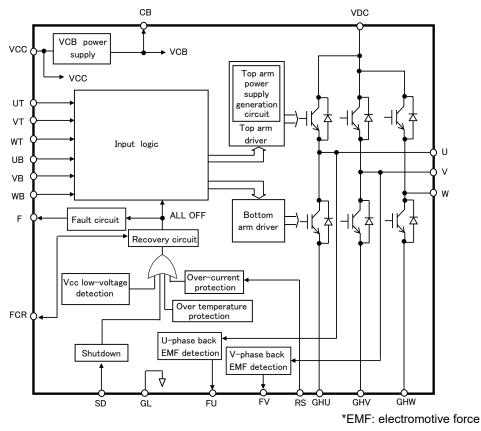


FIGURE 1.3.1 Block Diagram of IC

## 2. Content of Specifications

The following items have been described in the specifications.

- (1) Maximum ratings
  - It describes direct conditions (electric, thermal use conditions) leading to IC destruction, and so on. And the safety operating range with operating conditions is shown by minimum or maximum value.
  - In a case the specified values shown in each item are exceeded, products may be damaged or destroyed even for a moment. These specified values should never be exceeded under any operating conditions.
- (2) Electrical characteristics
  - · It provides for electric characteristics of the IC, and describes minimum, standard, and maximum.
- (3) Function and operation
  - It describes Truth Table, Timing Chart, Protection Function, and so on.
- (4) Standard application
  - It describes circuit examples and external components to operate IC.
- (5) SOA and deratings
  - It describes Safe Operation Area (SOA), deratings, and so on.
- (6) Pin assignments and pin definitions
  - It describes pin assignments, pin names and pin definitions.
- (7) Inspection
  - · It describes inspection conditions.
- (8) Important notice, precautions
  - It describes notes of the static electricity, the maximum rating, handling, and so on.
- (9) Appendix and reference data
  - · It describes packaging and dimensions.

# 3. Specifications

# 3.1 IC Types

Table 3.1.1 shows ratings, package types, and mounting types of the ICs.

**TABLE 3.1.1 IC and Package Types** 

No.	Type	Maximum ratings	Package type	Mounting type
1	ECN30624F		SOP26	Surface mount type
2	ECN30624R	Output device withstand voltage: 600V	SOP26R	Surface mount type
3	ECN30624P	Output current (Pulse) : 3A Output current (DC) : 2A	DIP26	Pin insertion type
4	ECN30624PN		DIP26N	Pin insertion type
5	ECN30625F		SOP26	Surface mount type
6	ECN30625R	Output dovice withstand voltage + 600V	SOP26R	Surface mount type
7	ECN30625P	Output device withstand voltage : 600V Output current (Pulse) : 2A Output current (DC) : 1A	DIP26	Pin insertion type
8	ECN30625PN		DIP26N	Pin insertion type
9	ECN30625S		HSOP37N	Surface mount type

## 3.2 Pin Assignments

Table 3.2.1 shows pin assignments of ECN30624F, ECN30624R, ECN30624P, ECN30624PN, ECN30625F, ECN30625R, ECN30625P, and ECN30625PN.

Table 3.2.2 shows pin assignments of ECN30625S.

**TABLE 3.2.1 Pin Assignments** 

(ECN30624F, ECN30624R, ECN30624P, ECN30624PN, ECN30625F, ECN30625R, ECN30625P, ECN30625PN)

Pin No.	Symbol	Pin functions	Remarks
1, 3, 20, 24	NC	No connection	Note 2
2	SD	For shutdown function	
4	VDC	High voltage power supply	Note 1
5	W	W-phase output	Note 1
6	V	V-phase output	Note 1
7	U	U-phase output	Note 1
8	GHW	Emitter of W-phase bottom arm IGBT and anode of W-phase bottom arm FWD	
9	GHV	Emitter of V-phase bottom arm IGBT and anode of V-phase bottom arm FWD	
10	GHU	Emitter of U-phase bottom arm IGBT and anode of U-phase bottom arm FWD	
11	RS	Input for over-current protection	
12	UB	Input control signal for U-phase bottom arm	
13	VB	Input control signal for V-phase bottom arm	
14	WB	Input control signal for W-phase bottom arm	
15	UT	Input control signal for U-phase top arm	
16	VT	Input control signal for V-phase top arm	
17	WT	Input control signal for W-phase top arm	
18	FU	U-phase back EMF signal output	
19	FV	V-phase back EMF signal output	
21	F	Fault signal output	
22	СВ	VCB power supply output	
23	FCR	For adjusting protection recovery time	
25	VCC	Control power supply	
26	GL	Ground	

Note 1. High voltage pin.

Note 2. Not connected to the chip in the IC.

Note 3. The tab potential is the same as that of the GL pin. Set the tab potential to open or the same as that of GND. If the tab is mounted on the external cabinet of the motor for heat radiation purposes, the IC will not be able to withstand an insulation withstand voltage test in which a high voltage is applied between the external cabinet and the GND. Please insert an insulation sheet or something similar between the IC tab and the external cabinet.

TABLE 3.2.2 Pin Assignments (ECN30625S)

Pin No.	Symbol	Pin functions	Remarks
2, 4, 5, 6,			
7, 11, 20,	NC	No connection	Note 1
27, 29, 31,	NC	No connection	Note 1
34, 36			
1, 22, 23,	GL	Cround	
37	GL	Ground	
3	VCC	Control power supply	
8	FCR	For adjusting protection recovery time	
9	СВ	VCB power supply output	
10	F	Fault signal output	
12	FV	V-phase back EMF signal output	
13	FU	U-phase back EMF signal output	
14	WT	Input control signal for W-phase top arm	
15	VT	Input control signal for V-phase top arm	
16	UT	Input control signal for U-phase top arm	
17	WB	Input control signal for W-phase bottom arm	
18	VB	Input control signal for V-phase bottom arm	
19	UB	Input control signal for U-phase bottom arm	
21	RS	Input for over-current protection	
24	GHU	Emitter of U-phase bottom arm IGBT and anode of U-phase bottom arm FWD	
25	GHV	Emitter of V-phase bottom arm IGBT and anode of V-phase bottom arm FWD	
26	GHW	Emitter of W-phase bottom arm IGBT and anode of W-phase bottom arm FWD	
28	U	U-phase output	Note 2
30	V	V-phase output	Note 2
32	W	W-phase output	Note 2
33	VDC	High voltage power supply	Note 2
35	SD	For shutdown function	

Note 1. Not connected to the chip in the IC.

Note 2. High voltage pin.

## 3.3 Functions of Pins

# TABLE 3.3.1 List of Pins and Functions (1/4)

No.	Pin	Pin functions	Functions and Precautions	Related items	Remarks
1	VCC	Control power supply	<ul> <li>Powers the drive circuits for the top and bottom arms, the built-in VCB supply circuit, and others.</li> <li>Determine the capacity of the power supply for Vcc allowing for a margin determined by adding the current taken out of the CB pin to the standby current ICC.</li> </ul>	<ul> <li>3.5.1 (1)</li> <li>Vcc low-voltage</li> <li>detection</li> <li>5.1 to 5.6</li> <li>Inverter IC destruction</li> <li>by surge or noise.</li> </ul>	_
2	VDC	High voltage power supply	Connected to the collectors of the top arm IGBTs.	• 5.1 to 5.4, 5.7 Inverter IC destruction by surge or noise.	High voltage pin
3	СВ	VCB power supply output	<ul> <li>Outputs a voltage (typ. 5.0V) generated in the built-in VCB power supply.</li> <li>VCB supply powers the IC internal circuits (input buffer, over-current protection and others) and can be used as a power supply for external circuits such as MCU, Hall elements, and so on.</li> <li>Connect an oscillation prevention capacitor C0 (1.0µF ±10% recommended) to the CB pin.</li> </ul>	• 3.5.4 VCB power supply	_
4	GL	Ground	It is the ground pin for Vcc and VCB power lines.	_	_
5	GHU GHV GHW	Emitter of U/V/W-phase bottom arm IGBT and anode of U/V/W-phase bottom arm FWD	<ul> <li>The GHU, GHV and GHW pins are connected to the emitters of the U-phase, V-phase and W-phase bottom arm IGBTs respectively.</li> <li>The current in each phase can be detected by connecting a shunt resistor Rs between these pins (GHU, GHV, GHW) and the GL pin.</li> <li>DC current can be detected by connecting the GHU, GHV and GHW pins all together and connecting a shunt resistor Rs between the RS pin and the GL pin.</li> </ul>	• 3.5.1 (2) Setting method for over- current protection	_
6	U V W	U/V/W-phase output	These are outputs of a three-phase bridge consisting of six IGBTs and free wheel diodes.	-	High voltage pin

TABLE 3.3.1 List of Pins and Functions (2/4)

No.	Pin	Pin functions	Functions and Precautions	Related items	Remarks
7	UT VT WT UB VB WB	Input control signal for U/V/W-phase top/bottom arm	<ul> <li>Inputs control signals of each phase.</li> <li>When inputting "H", the IGBTs turn on. When inputting "L", the IGBTs turn off.</li> <li>U, V and W stand for each phase. T and B stand for top arm and bottom arm respectively.</li> <li>If the switching noise is monitored, mount a capacitor.</li> <li>The maximum rating of input voltage is VCB+0.5V.</li> </ul>	_	_
		FIG	VCB  VT  VT  WT  UB  VB  WB  VB  Z000k Ω  Z000k Ω  TOTAL TO	s, WB Pins	
8	RS	Input for over- current protection	Monitors the voltage of the shunt resistor Rs and detects over current status.	• 3.5.1 (2) Setting method for over- current protection	-
			RS typ. 200k Ω  FIGURE 3.3.2 Equivalent Circuit Around RS Pin		

TABLE 3.3.1 List of Pins and Functions (3/4)

No.	Pin	Pin functions	Functions and Precautions	Related items	Remarks
9	FU FV	U/V-phase back EMF signal output	<ul> <li>NMOS open drain output pin. Pull up to the CB pin or 5V through an external resistor RFU, RFV (10kΩ±5% recommended).</li> <li>Outputs U-phase and V-phase back EMF signal when input signals to the control input pins of each arm are all "L" (UT, VT, WT, UB, VB, WB = L).</li> <li>Outputs "H" independently when each voltage at the U and V pins is VIHE or more. Outputs "L" independently when each voltage at the U and V pins is VILE or less.</li> </ul>	3.5.5 Back EMF detection (Back electromotive force detection)	
			VCB FU FV		
			FIGURE 3.3.3 Equivalent Circuit Around FU, FV Pi	ns	
10	F	Fault signal output	<ul> <li>NMOS open drain output pin</li> <li>The NMOS turns on only when the protection function operates, and in other cases, the NMOS is off.</li> <li>Pull up to the CB pin or 5V through an external resistor RF. Moreover, to remove switching noise, connect the capacitor CF (0.01µF±10% recommended) between the F pin and GND.</li> </ul>	• 3.5.1 Protection function	_
			VCC F		
İ			FIGURE 3.3.4 Equivalent Circuit Around F Pin		

TABLE 3.3.1 List of Pins and Functions (4/4)

FCR For adjusting protection recovery time  NMOS open drain pin. Outputs "L" when any of the protection recovery current, over temperature, or shut After that, when the protection resatisfied and protection recover determined by RFCR and CFCR and F pin outputs are "H", and the in which the IGBTs operate dependence." "L" is not outputted when the Voc operates. After the protection resatisfied and reprotection	adjusting function
FCR  FIGURE 3.3.5 Equivalent Cir  12 SD For shutdown function  • When this function is used as an one on the VDC pin, connect the extension of the VDC pin, connect the vDC pin, connect the extension of the VDC pin, connect the vDC pin, connec	
12 SD For shutdown function when this function is used as an or on the VDC pin, connect the extension ROVP2 and a capacitor COV	Puit Around ECP Pin
	ver-voltage protection • 3.5.1 (4) nal resistors ROVP1, Shutdown function
SD VCB	


## 3.4 Markings

Marks are indicated by laser marking on the following part:

SOP26, SOP26R, DIP26, HSOP37N: resin part of IC front side

DIP26N: resin part of IC back side


Side of Pin 1

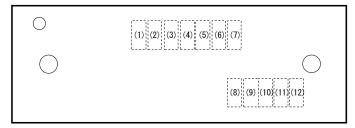

Side of Pin 26

FIGURE 3.4.1 SOP26 Marking Specifications


Side of Pin 26

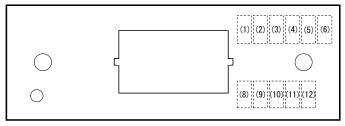

Side of Pin 1

FIGURE 3.4.2 SOP26R, DIP26 Marking Specifications

Side of Pin 1

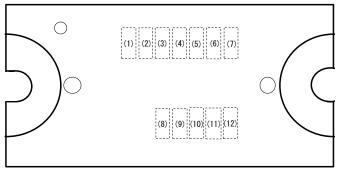

Side of Pin 26

FIGURE 3.4.3 DIP26N Marking Specifications

No. (1) to (7): Type name No. (8) to (12): Lot number

The lot number consists of the followings.

No. (8): Last one-digit of the year of assembly

No. (9): Month of assembly:


January: A, February: B, March: C April: D, May: E, June: K,

July: L, August: M, September: N, October: X, November: Y, December: Z

No. (10) to (12): Quality control number

Represented with letters from "A" to "Z" except "I, O, and Q", numbers from "0" to "9", or blank.

## Side of Pin 37

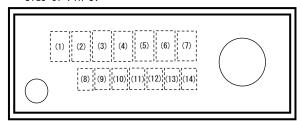

Side of Pin 1

FIGURE 3.4.4 HSOP37N Marking Specifications

Mark No. (1) to (7): Type name Mark No. (8) to (14): Lot number

The lot number consists of the followings.

No. (9) (10): Last two digits of the year of assembly

No. (11): Month of assembly:

January: A, February: B, March: C April: D, May: E, June: K,

July: L, August: M, September: N, October: X, November: Y, December: Z

No. (12) to (14): Quality control number

Represented with letters from "A" to "Z" except "I and O", numbers from "0" to "9", or blank.

## 3.5 Functions and Operational Precautions

#### 3.5.1 Protection Function

## (1) Vcc low-voltage detection

We call the Vcc low-voltage detection "LVSD". When the Vcc voltage drops below the LVSD operating voltage (LVSDON, typ.12.0V), the F output is "L", and all IGBTs (top and bottom arms) are turned off. When the Vcc voltage goes up to a level equal to or exceeding the LVSD recovery voltage (LVSDOFF, typ. 12.5V) and the protection recovery time (Trs2) passes, the F output is "H", and the IC automatically returns to a state in which the IGBTs operate depending on input signals. The protection recovery time is fixed at Trs2.

FIGURE 3.5.1.1 shows the timing chart for the Vcc low-voltage detection operation.

If the Vcc low-voltage detection operates during motor rotation, Vdc voltage may rise due to regenerative electric power to the Vdc power supply. The voltage at the VDC pin must not exceed the maximum rating. Particular attention is needed when the capacitance of a capacitor between the VDC and GND is small, because it makes the voltage more likely to rise.

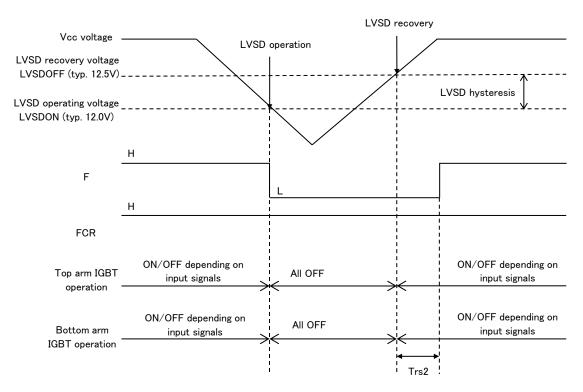


FIGURE 3.5.1.1 Timing Chart for Vcc Low-voltage Detection Operation

## (2) Setting method for over-current protection

Figure 3.5.1.2 shows an example of the current flowing through the shunt resistor Rs when this function is enabled. This function is not effective for currents that do not flow forward (direction to the GL pin) through the shunt resistor, such as reflux current and power regenerative current (see Figures 3.5.1.3 and 3.5.1.4).

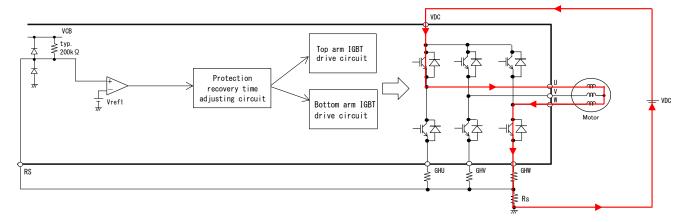


FIGURE 3.5.1.2 Example of Current Path of Enabled Over-current Protection

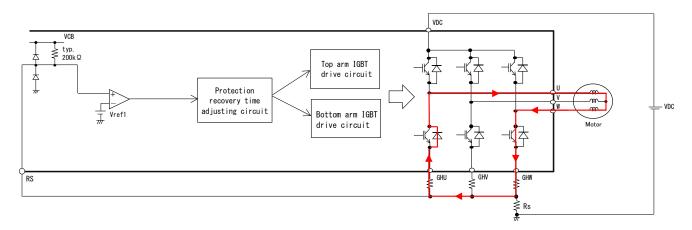


FIGURE 3.5.1.3 Example of Reflux Current

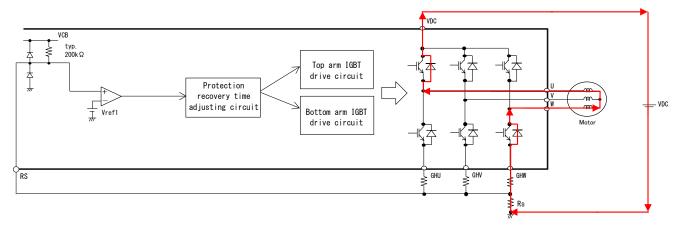


FIGURE 3.5.1.4 Example of Power Regenerative Current

## (a) Over-current protection

When the voltage at the RS pin reaches the over-current protection reference voltage (Vref1, typ. 0.80V), the F output is "L", and all IGBTs (top and bottom arms) are turned off. When the voltage at the RS pin drops below the over-current protection reference voltage (Vref1, typ. 0.80V) and the over-current protection recovery time passes, the F output is "H", and the IC automatically returns to a state in which the IGBTs operate depending on input signals. The protection recovery time is adjustable using FCR pin, and the adjustment method is shown in Section 3.5.1 (5).

Figure 3.5.1.5 shows the timing chart for the over-current protection operation.

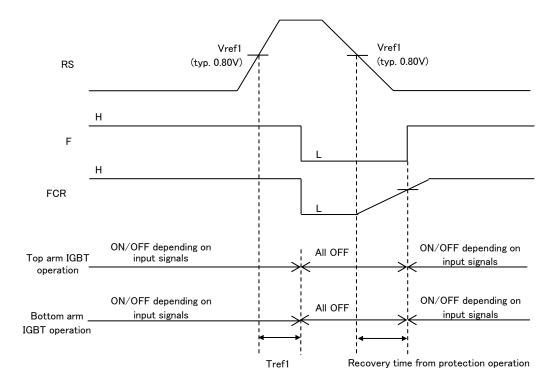


FIGURE 3.5.1.5 Timing Chart for Over-current Protection Operation

## (b) How to set current value of over-current protection

The over-current protection set value (IO) is calculated as follows:

IO=Vref1/Rs

Where

Vref1: Over-current protection reference voltage

Rs : Shunt resistance value

In setting current values, delay time to turn the IGBT off (Tref1), Vref1 variability and Rs variability need to be considered. Observe the output currents of the IC (the coil currents of the motor) and confirm a design margin. Set the shunt resistance so that voltages of the GHU, GHV, and GHW pins are within the specified GH voltage (Vgh) range in the Product Specification.

## (c) Wiring precautions

Make the wiring of the shunt resistor Rs as short as possible. The GHU, GHV and GHW are connected to the IGBT emitters. If the wiring has high resistance or high inductance component, the emitter potential of the IGBT changes, which can result in IGBT malfunction.

## (3) Over temperature protection

We call the Over temperature protection "TSD". When the IC temperature exceeds the TSD operating temperature (TSDON, typ. 160°C), the F output is "L", and all IGBTs (top and bottom arms) are turned off. When the IC temperature goes down the hysteresis (TSDHYS, typ. 25°C) from the TSD operating temperature (TSDON, typ. 160°C) and protection recovery time passes, the F output is "H", and the IC automatically returns to a state in which the IGBTs operate depending on input signals. The protection recovery time is adjustable using FCR pin, and the adjustment method is shown in Section 3.5.1 (5).

Figure 3.5.1.6 shows the timing chart for the over temperature protection operation.

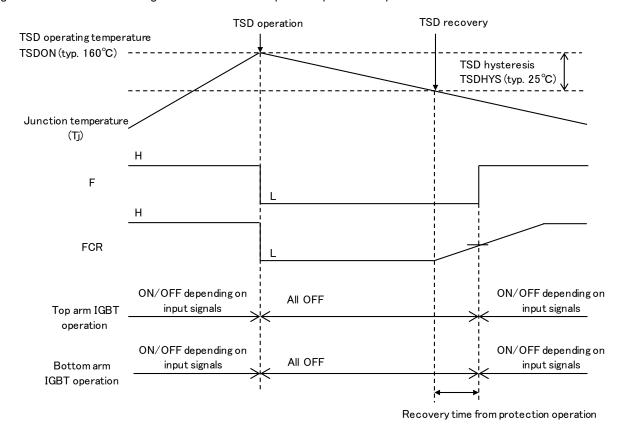


FIGURE 3.5.1.6 Timing Chart for Over Temperature Protection Operation

## (4) Shutdown function

When the voltage at the SD pin reaches the shutdown operating voltage (Vref2, typ. 1.23V), the F output is "L", and all IGBTs (top and bottom arms) are turned off. After that, when the voltage at the SD pin falls below the shutdown recovery voltage (Vref3, typ. 1.18V) and protection recovery time passes, the F output is "H", and the IC automatically returns to a state in which the IGBTs operate depending on input signals. The protection recovery time is adjustable using the FCR pin, and the adjustment method is shown in Section 3.5.1 (5).

This function can be used as an over-voltage protection when over-voltage is applied on the VDC pin. The operating voltage and recovery voltage of the over-voltage protection are adjustable by the resistance values of external resistors ROVP1 and ROVP2 which are connected between the VDC pin and GL pin. These voltages can be calculated using the following equations:

Over-voltage protection operating voltage: OVPON(V) = 
$$\frac{\text{ROVP1}(\Omega) + \text{ROVP2}(\Omega)}{\text{ROVP2}(\Omega)} \times \text{Vref2}(V)$$
Over-voltage protection recovery voltage: OVPOFF(V) = 
$$\frac{\text{ROVP1}(\Omega) + \text{ROVP2}(\Omega)}{\text{ROVP2}(\Omega)} \times \text{Vref3}(V)$$
this function is not used, connect the SD pin to the GL pin. Figure 3.5.1.7 shows the timing of

When this function is not used, connect the SD pin to the GL pin. Figure 3.5.1.7 shows the timing chart for shutdown operation.

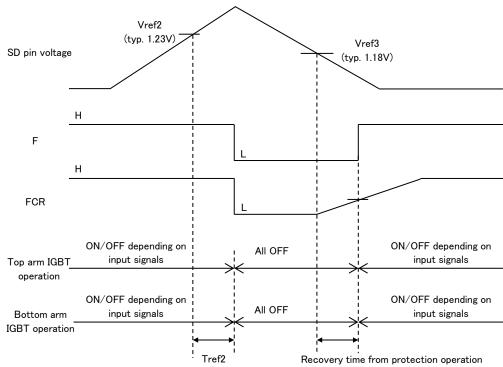


FIGURE 3.5.1.7 Timing Chart for Shutdown Operation

#### (5) Protection recovery time adjusting function

The FCR pin is used for adjusting the protection recovery time. Connect the RFCR and CFCR between the CB pin and GL pin. Then, connect the midpoint of the CB pin and GL pin to the FCR pin. See the connection example in Figure 4.1.1. When any of the protection functions (over-current, over temperature, or shutdown function) operates, the voltage at the FCR pin is "L". After that, when the protection recovery conditions are satisfied and protection recovery time (Trs) determined by RFCR and CFCR passes, the F output is "H", and the IC returns to a state in which the IGBTs operate depending on input signals. On the other hand, when RFCR= $10k\Omega$  is connected between the CB pin and FCR pin with the CFCR unconnected, after the protection recovery conditions are satisfied and protection recovery time (Trs2) determined by the internal circuit passes, the F output is "H", and the IC returns to a state in which the IGBTs operate depending on input signals. When the Vcc low-voltage detection operates, the protection recovery time is Trs2 regardless of RFCR and CFCR values.

Trs can be calculated as follows.

Trs(ms) = Trs1 (ms) \* 
$$\times \frac{\text{RFCR}(M\Omega) \times \text{CFCR}(pF)}{1(M\Omega) \times 1000(pF)}$$

\* Trs1 (typ. 1ms)


Please set RFCR to  $500k\Omega$  to  $2M\Omega$  and CFCR to 1000pF to 5000pF as a guide.


Table 3.5.1 shows the relationship between each protection function and protection recovery time.

Figure 3.5.1.8 shows the timing chart in case of FCR pin connected to RFCR and CFCR. Figure 3.5.1.9 shows the timing chart in case of RFCR= $10k\Omega$  connected to FCR pin with CFCR unconnected.

TABLE 3.5.1 Relationship Between Protection and Protection Recovery Time

	Protection recovery time	
	When protection recovery time	When protection recovery time adjusting function
Protection function	adjusting function is enabled	is disabled
	(When RFCR, CFCR are connected	(When RFCR=10kΩ is connected to FCR pin with
	to FCR pin)	CFCR unconnected)
Vcc low-voltage detection	Trs2	
Over-current protection		Trs2
Over temperature protection	Trs	1152
Shutdown function		

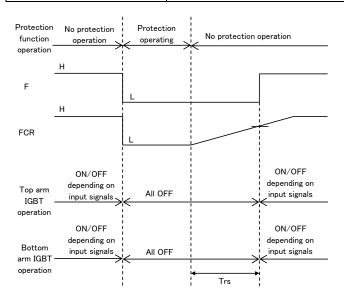



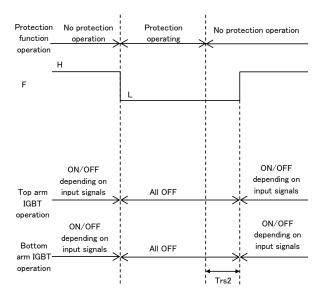


FIGURE 3.5.1.9
Timing Chart in Case of Protection Recovery
Time Adjusting Function Disabled

#### (6) Short-circuit protection

If output of the inverter is short-circuited (load short-circuit, earth fault, and short-circuit between the top and bottom arms), there is a possibility that the IC will be destroyed. The over-current protection prevents damage to the IC due to load short-circuit and short-circuit between the top and bottom arms. However, in the case of earth fault whose current does not flow through the shunt resistor, the over-current protection does not operate because the IC cannot detect over-current. Thus, be sure to protect the device using external circuits of the IC in order to prevent damage caused when the IC cannot detect over-current such as an earth fault. Two or more occurrences of short-circuits can lead to the IC damage or failure because of local heat generated in the IGBTs. Proper precautions should be taken to prevent the over-current protection from operating repeatedly more than once caused by short-circuit.

#### 3.5.2 New Bootstrap

The new bootstrap is a power supply method for the top arm that is characterized by charging the built-in capacitor in the IC from the Vdc power supply (high voltage power supply). A low PWM frequency lowers the charge voltage in the built-in capacitor, which could cause a higher voltage drop of the top arm output. As a guide, the PWM frequency should be 20 kHz (14 kHz  $\leq$  fPWM  $\leq$  30 kHz is recommended).

If the output ON-duty is high, a voltage drop of the top arm output may increase because the charging time of the built-in capacitor is insufficient. The output ON-duty ratio should be 98% or less.

When the Vdc power supply voltage is low, the built-in capacitor is not sufficiently charged. That could cause a higher voltage drop of the top arm output. The Vdc power supply voltage should be within the voltage range specified in the Product Specification.

#### 3.5.3 Power On/Off Sequence

Sequence free in followings (1), (2), and (3).

- (1) Power-on sequence
- (2) Power-off sequence
- (3) Power-off and reset operation in instantaneous power failure occurrence

## 3.5.4 VCB Power Supply

The VCB power supply is generated from Vcc power supply and outputted from the CB pin. The VCB power is supplied to the IC internal circuits such as the over-current protection circuit. Figure 3.5.4.1 shows an equivalent circuit. This circuit constitutes a feedback circuit.

To prevent oscillation, connect capacitor C0 to the CB pin. The recommended capacitance for the C0 is  $1.0\mu F\pm 10\%$ . The larger the C0 capacity, the more stable the VCB power supply. However, excessive capacitance is not recommended. As a guide, it should be  $2\mu F$  to  $3\mu F$  or less.

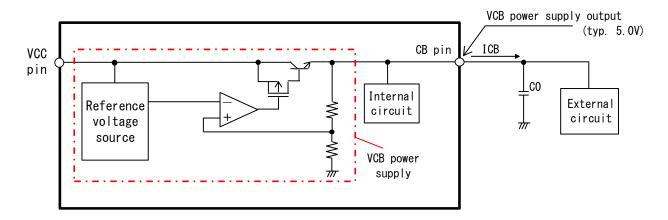


FIGURE 3.5.4.1 Equivalent Circuit for VCB Power Supply

#### 3.5.5 Back EMF Detection (Back electromotive force detection)

When an external force makes the motor rotate (free-running) while the inverter stops operating, the back EMF signals are outputted as information on the rotor position. The U-phase back EMF signal and V-phase back EMF signal are outputted from the FU and FV pins respectively. Figure 3.5.5.1 shows a timing chart. A condition to output the back EMF signals is satisfied when the UT, VT, WT, UB, VB and WB pin inputs are all "L". In the other conditions, you must not use the signals from the FU and FV pins as the information on the rotor position. When motor speed is decreased and the back EMF goes down below the detection level (VILE), the FU and FV pin outputs are "L". In using this signal, consider motor variance and detection level variance.

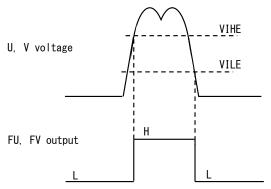


FIGURE 3.5.5.1 Timing Chart for Motor Output (U, V) and FU, FV Pin Signal Output

#### 3.5.6 Internal Filter Circuit

Internal filter circuits are located before the top and bottom arm drivers. The filter circuits remove signals and switching noise with widths less than about 0.5µs inputted to the input pins (UT, VT, WT, UB, VB, WB).

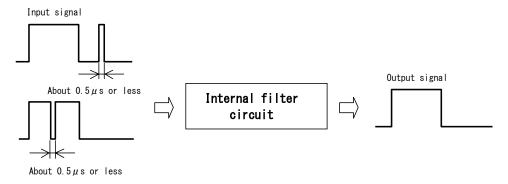


FIGURE 3.5.6.1 Operation of Internal Filter Circuit

## 3.5.7 Derating

How much to derate a unit from the maximum rating is an important issue to consider for a reliable design. Items to be considered in the stage of system design include the derating of voltage, current, power, load, and electric stresses, along with the derating of temperature, humidity, other environmental conditions, vibration, impact, and other mechanical stresses.

Table 3.5.7.1 specifies the standard examples of derating to be considered when creating a reliable design. To consider these derating items in the equipment design stage is desirable for achieving reliability. If any item is difficult to be controlled within the standard, another means will be necessary, such as selecting a device having higher maximum ratings. Please consult our sales representative in advance.

**TABLE 3.5.7.1 Typical Derating Design Standards** 

	Туре	
Item	ECN30624F, ECN30624R ECN30624P, ECN30624PN	ECN30625F, ECN30625R, ECN30625P ECN30625PN, ECN30625S
Junction temperature Tj	110°C maximum	
Vdc power supply voltage	450V maximum	
Output peak current	1.4A maximum	0.7A maximum

## 3.6 Handling

#### 3.6.1 Mounting

#### (1) Insulation between pins

High voltages are applied between the pin numbers specified below. Please apply coating resin or molding treatment as necessary.

- SOP26, SOP26R, DIP26, DIP26N: Between pin numbers: 2-3, 4-5, 5-6, 6-7, 7-8
- HSOP37N: Between pin numbers: 26-28, 28-30, 30-32, 32-33, 33-35

#### (2) Connection of tabs

The tab and the GL pin of the IC are connected in the frame. Regarding the tab, take note of the following points.

#### (a) SOP26

Leave the tab unconnected or set the tab potential to the same as that of the GL pin.

The tab is placed on the IC lower surface (on PCB side). Wiring lines other than GND on the PCB must not touch the tab even if a coating such as solder resist is applied. Please secure sufficient insulation distance particularly between high voltage wiring lines and the tab.

## (b) SOP26R, DIP26

Leave the tab unconnected or set the tab potential to the same as that of the GL pin.

The tab is placed on the IC upper surface. If it is required to insulate between the IC tab and the housing, please insert an insulation sheet or something similar between them. If the insulation between the tab and the housing is insufficient, the IC will not be able to withstand an isolation withstand voltage test in which a high voltage is applied between the housing and the GND.

#### (c) DIP26N

The tab is placed on the IC upper surface. If a heat sink is attached to the tab by screwing, set the heat sink potential to the same as that of the GL pin. If a heat sink is not attached to the tab and it is required to insulate between the IC tab and the housing, please insert an insulation sheet or something similar between them. If the insulation between the tab and the housing is insufficient, the IC will not be able to withstand an isolation withstand voltage test in which a high voltage is applied between the housing and the GND.


## (3) Lead pin reliability

When using DIP26N with the heat sink attached, the lead pin can be destroyed by vibration or impact depending on conditions of use because a load is applied to the lead pin. Please sufficiently assess the IC by a vibration test after mounting the IC. In particular, please note that space between the IC body (resin part) and PCB increases a load.

## (4) Tab suspension

Figure 3.6.1.1 shows a side view of the IC.

There are parts called "tab suspension" on both side surfaces of the IC. These tab suspensions are connected to the same potential as the GL pin. When the high voltage wire or/and components are laid out close to the tab suspensions, insulate them with coating, mold, or other treatment.



#### FIGURE 3.6.1.1 Side Views of ICs

## (5) Coating resin

The influence of coating resin on semiconductor devices (thermal stress, mechanical stress and other stress) depends on PCB size, mounted components, etc. to be used. When selecting a coating resin, consult with your PCB manufacturer and resin manufacturer.

## (6) Soldering conditions

#### (a) Soldering condition for SOP26, SOP26R, HSOP37N

This IC is lead-free (Pb-free). The recommended reflow soldering condition is shown in Figure 3.6.1.2. If attaching a heat sink to SOP26R, do not solder to the tab. The solder on the tab impairs the tab flatness, which causes poor contact with the heat sink mounting surface. As a result, the heat dissipation may decrease.

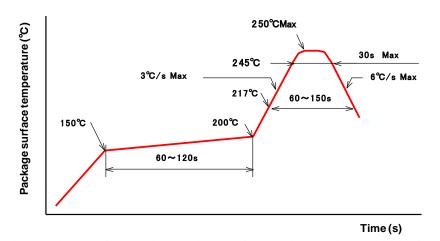


FIGURE 3.6.1.2 Recommended Conditions for Infrared Reflow or Air Reflow

## (b) Soldering condition for DIP26, DIP26N

The peak temperature of flow soldering\* must be 260°C or less, and the dip time must be within 10 seconds. High stress by mounting, such as long time thermal stress by preheating, mechanical stress, etc., can lead to degradation or destruction. Make sure that your mounting method does not cause problem as a system.

If attaching a heat sink, do not solder to the tab. The solder on the tab impairs the tab flatness, which causes poor contact with the heat sink mounting surface. As a result, the heat dissipation may decrease.

X Flow soldering: Only pins enter a solder bath, while the resin or tab does not.

## (7) Solder joint reliability

Reliability of solder joints is influenced by soldering conditions, PCB material and foot patterns. Perform adequate evaluations on thermal cycle tests, heat shock tests, and other tests after mounting the IC on a PCB. Special care should be taken if the HSOP37N is mounted on a PCB having a high coefficient of thermal expansion (such as CEM-3) because the solder joint life could be shortened.

#### 3.6.2 Precautions for Mounting Heat Sink

To radiate heat of the IC, attaching a heat sink to the tab side is effective. When attaching a heat sink, please select DIP26N. Then, it is recommended to attach a heat sink to the IC body (resin part) by screwing. If other methods are used such as attaching with a clip or attaching to PCB by screwing, problems can be caused such as variation of adhesion strength between a heat sink and the IC or deterioration in reliability of attachment points. For these reasons, please select and adopt a method at the user's own responsibility. When attaching a heat sink to DIP26N by screwing, set the heat sink potential to the same as that of the GL pin and note the following points.

## (1) Heat sink

Inappropriate heat sinks will hinder heat radiation. In addition, adding unnecessary stress will cause characteristic degradation or resin cracks.

Observe the following points regarding heat sinks:

- (a) To avoid a heat sink causing convex or concave warping, keep the warp and twisting between screw holes less than or equal to 0.05 mm (Figure 3.6.2.1).
- (b) For aluminum, copper, and iron boards, make sure there is no press tension, and always bevel the screw holes.
- (c) A contact surface with the IC must be ground flat. (Average surface roughness **Ra** shall be 3.2 to 6.3 μm.)
- (d) Prevent and remove any shaved particles between the IC tab and the heat sink.
- (e) Make sure the screw hole gaps match those of the IC (typ. 29.5mm). If they are too wide or too narrow, resin cracks may occur.

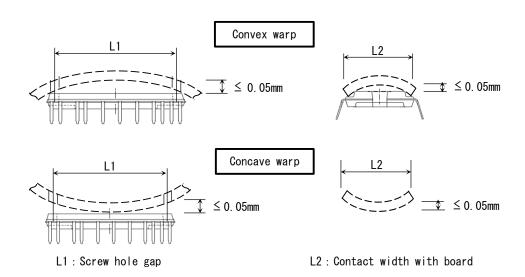


FIGURE 3.6.2.1 Heat Sink Warping

## (2) Screws

The screws that attach the heat sink to the device are generally classified into small screws and tapping screws. Observe the following precautions when using these types of screws:

- (a) Use small bind and truss screws that have heads which meet JIS-B1101 standards.
- (b) Avoid using countersink screws, which add abnormal stress to devices (Figure 3.6.2.2).
- (c) The use of tapping screws increases tightening torque. Therefore, there is a possibility that desired contact resistance cannot be obtained. When using tapping screws, prevent tightening torque from becoming too large. For tightening torque, see Section 3.6.2 (3).
- (d) When using a tapping screw, use one that is thinner than the IC attachment hole diameter. If thicker screws are used, tapping the IC attachment holes or heat sinks can promote failures.

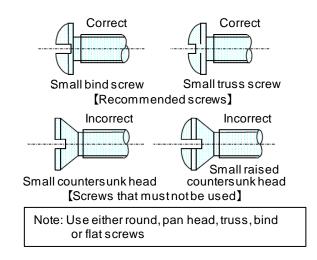



FIGURE 3.6.2.2 Recommended and Prohibited Screws

## (3) Tightening method

Insufficient tightening torque invites an increase in heat resistance, and excessive torque invites such failures as warping of the device, cracking of resin, die destruction, and connector lead breakage. Please use the tightening torque value 0.39 to 0.59N·m (4 to 6 kg·cm). (Attached screw: M3)

Use a manual torque screwdriver or electric screwdriver for tightening. Do not use an impact driver. When using an electric screwdriver, the maximum rotation speed at the time of tightening must be 700 rpm. If tightened at higher speeds than 700 rpm, the IC is overstressed, which may result in resin cracking.

Tightening sequence is shown as Figure 3.6.2.3.

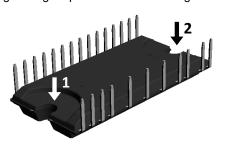

(a) Tightening sequence

Temporary tightening: 1 -> 2 Final tightening: 1 -> 2

Torque for temporary tightening should be 20 - 30 % of maximum torque.

(b) Flat washer or spring washer should be put in. IC might get crack without the washer.

FIGURE 3.6.2.3 Typical Tightening Sequence

## (4) Silicone grease

Apply a thin layer (100um or less) of silicon grease evenly over the contact surface between the IC and the heat sink to maximize heat conduction. Applying more silicon grease than necessary may reduce heat dissipation and overstress the IC, which may result in resin cracking. Moreover, avoid high-viscosity (hard) greases to prevent resin from cracking.

Example of silicone grease is shown in Table 3.6.2.1. We recommend the silicone grease shown below or comparable one.

**TABLE 3.6.2.1 Recommended Silicone Grease** 

No.	Product name	Manufacturer
1	G-747	Shin-Etsu Chemical Co., Ltd

## 4. Recommended Circuit

## 4.1 External Components

Table 4.1.1 shows recommended external components.

**TABLE 4.1.1 External Components** 

Component	Standard value	Usage	Remarks
C0	1.0µF±10%, 25V	Smooths the internal power supply (VCB)	
CV1	1.0µF±10%, 25V	Smooths the Vcc power supply	Note 1
CV2	33nF±10%, 630V	Smooths the Vdc power supply	Note 1
Rs	1Ω±1%, 1W	Sets over-current protection	Note 2 for how to set Rs.
RFU, RFV	10kΩ±5%	For pull up	
CF	0.01µF±10%, 25V	Eliminates output noise of Fault signal	
RF	10kΩ±10%	For pull up	
CFCR	1000pF±10%, 25V	Sets protection recovery time	When the protection recovery time adjusting
RFCR	1MΩ±10%		function is enabled, connect RFCR and CFCR to FCR pin.
CFCR	-	-	When the protection recovery time adjusting
RFCR	10kΩ±10%	For pull up	function is disabled, connect RFCR to FCR pin and do not connect CFCR to FCR pin.
ROVP1	_	Sets over-voltage protection operating voltage/recovery voltage	Note 3 for how to set ROVP1.
ROVP2	_	Sets over-voltage protection operating voltage/recovery voltage	Note 3 for how to set ROVP2.
COVP	0.1µF±10%, 25V	Eliminates input noise of SD signal	Note 4

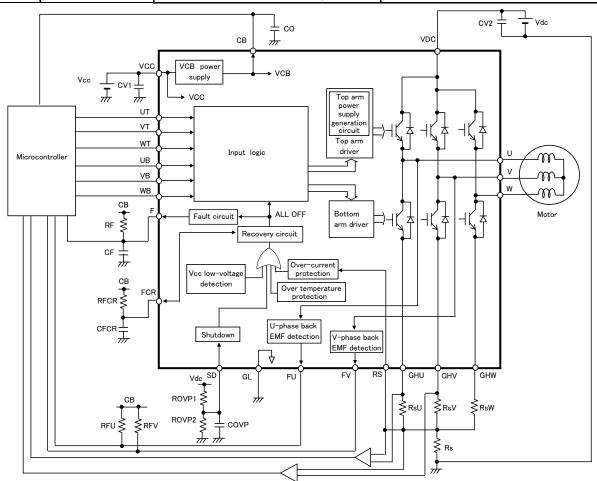


FIGURE 4.1.1 Block Diagram and External Components of IC

# Note 1. Caution for smoothing capacitor

As necessary, increase the capacitance and add a zener diode in consideration of noise immunity. Mount each of the components close to the pins of the IC.

- Note 2. Section 3.5.1 (2) (b) shows how to set the resistance value.
- Note 3. Section 3.5.1 (4) shows how to set the resistance value.
- Note 4. When influence of noise or others is large, adjust the capacitance of the capacitor as necessary.

## 4.2 Other External Components

It is recommended to mount the components shown in Table 4.2.1 to stabilize the power supply and protect the IC from voltage surge.

Adjust the settings of components in accordance with the conditions of use. Moreover, mount each of the components close to the pins of the IC to achieve the effect of the voltage surge absorption.

**TABLE 4.2.1 Other External Components** 

No.	Components	Purpose	Remarks
1	Cvcc1	for VCC. To suppress high frequency noise	Ceramic capacitor with good frequency response, etc. About 1µF
2	Cvcc2	for VCC. To smooth Vcc power supply	Electrolytic capacitor, etc. About 1µF
3	ZDvcc	for VCC. To suppress over voltage	Zener diode with good frequency response
4	VDC	for VDC. To suppress high frequency noise	Ceramic capacitor with good frequency response, etc. About 33nF/630V
		for VDC. To smooth Vdc power supply	Electrolytic capacitor, etc. About 1µF/630V

#### 5. Failure Examples (Assumptions)

- 5.1 Inverter IC Destruction by External Surge Inputted to Vdc and Vcc Lines (Case 1)
- Cause : An external surge entered the IC on the Vdc and Vcc lines of the motor. Because the capacitance of the bypass capacitor for surge suppression was small, the surge could not be sufficiently suppressed.
- Phenomenon : The motor does not rotate due to the over-voltage destruction of the IC.
- · Countermeasure: Use the bypass capacitor for surge suppression; its capacity should be enough to suppress surges.

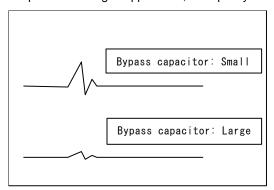


FIGURE 5.1.1 Example of Surge Waveforms for Different Capacitance of Bypass Capacitor

5.2 Inverter IC Destruction by External Surge Inputted to Vdc and Vcc Lines (Case 2)

- Cause : An external surge entered the IC on the Vdc and Vcc lines of the motor. Because the external
  components for surge suppression were positioned far from the IC on the circuit board, the surge
  could not be sufficiently suppressed.
- Phenomenon : The motor does not rotate due to the over-voltage destruction of the IC.
- · Countermeasure : The bypass capacitor and Zener diode for surge suppression should be mounted close to the IC.

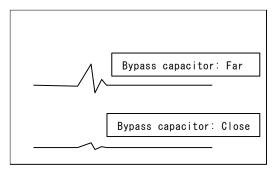


FIGURE 5.2.1 Example of Surge Waveform for Different Bypass Capacitor Locations on the Board

5.3 Inverter IC Destruction by External Surge Inputted to Vdc and Vcc Lines (Case 3)

- Cause : When a power supply line was in an open state due to the connector contact failure of the Vdc and Vcc line or the like, the supply power was turned on. Then, when the power supply line went into a closed state, an external surge occurred and entered the IC.
- Phenomenon : The motor does not rotate due to the over-voltage destruction of the IC.
- · Countermeasure : The Zener diode for surge suppression should be mounted close to the IC.

5.4 Inverter IC Destruction by External Surge Inputted to Vdc and Vcc Lines (Case 4)

- Cause : An external surge entered the IC on the Vdc and Vcc lines of the motor. Because the Zener voltage of the surge suppressor diode was higher than the maximum rating voltage of the IC, it did not protect the IC
- Phenomenon : The motor does not rotate due to the over-voltage destruction of the IC.
- Countermeasure: Use a surge suppressor diode with Zener voltage which is lower than the maximum rating voltage of the IC. The larger the rating capacity of the Zener diode, the more effectively the surge suppressor works.

## 5.5 Inverter IC Destruction by External Surge Inputted to Vcc Line

- Cause : Pulsed noise of a voltage that was lower than the LVSD operating voltage (LVSDON) entered the Vcc line. In this case, the IC repeats split-second protection function operation. Then the IC has the possibility of overheat breakage.
- Phenomenon : The motor does not rotate due to the destruction of the IC.
- Countermeasure: ① Remove the noise that enters the motor Vcc line by reviewing the power supply circuit (inductance of power cable, noise filter circuit or the like).
  - ② Connect a capacitor having sufficient capacitance close to the VCC pin and GL pin of the IC to absorb noise.

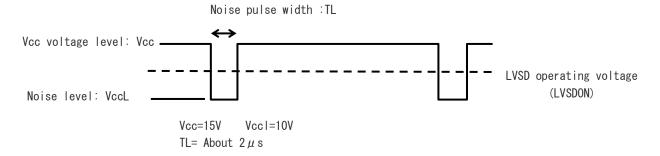


FIGURE 5.5.1 Example of Pulsed Noise on Vcc Line

## 5.6 Inverter IC Destruction by Vcc Line Noise

· Cause : Surge voltage that exceeded the maximum rating for the IC entered the VCC pin.

• Phenomenon : The motor does not rotate due to the over-voltage destruction of the IC.

- · Countermeasure:
  - ① Mount a bypass capacitor C1 near the pin of the IC. Use a capacitor that has excellent frequency characteristics, such as a ceramic capacitor. As a guide, a capacitor of around 1µF is recommended.
  - ② It is more effective to mount a surge suppression device, such as bypass capacitor C2 shown in Figure 5.6.1, close to the connector of a motor control circuit board.

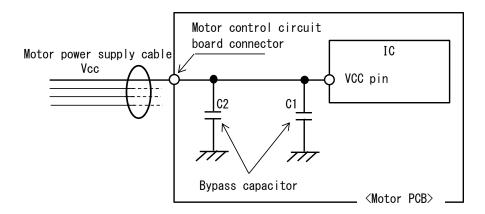


FIGURE 5.6.1 Example of Mounted Surge Suppression Devices

## 5.7 Inverter IC Destruction by Noise at Vdc Power Supply Power-on

• Cause : Surge voltage that exceeded the maximum rating for the IC entered the VDC pin because the voltage rose suddenly when the Vdc power supply was powered on.

• Phenomenon : The motor does not rotate due to the over-voltage destruction of the IC.

• Countermeasure: Mount a power supply smoothing capacitor near the VDC pin of the IC. An electrolytic capacitor is generally used as a power supply smoothing capacitor.

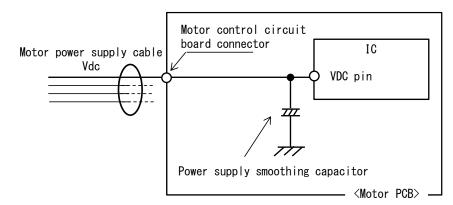


FIGURE 5.7.1 Example of Mounted Power Supply Smoothing Capacitor

5.8 Inverter IC Destruction by Inspection Machine Relay Noise

• Cause : A mechanical relay for on-off control of the electric connection between the IC and an inspection machine generated a surge that entered the IC.

• Phenomenon : The motor does not rotate due to the over-voltage destruction of the IC.

• Countermeasure : Use a semiconductor relay, etc. Confirm a surge generated when the relay is on-off is less than the maximum rated value.



FIGURE 5.8.1 Example of Surge Waveform When Mechanical Relay is Used

## 5.9 Motor Failure (Missing Phase Output)

• Cause : The motor with missing phase has been out on the market.

• Phenomenon : The motor might start depending on the rotor position when starting even if the motor has missing phase output. Therefore, the missing phase output of motor cannot be detected by the motor rotation test.

• Countermeasure: Monitor the motor current or oscillation in order to detect the missing phase output of motor.

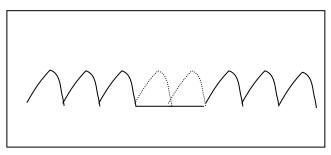


FIGURE 5.9.1 Example of Motor Current Waveform in Phase Missing Condition

#### 6. Precautions for Use

- 6.1 Countermeasures against Electrostatic Discharge (ESD)
  - (a) Customers need to take precautions to protect ICs from electrostatic discharge (ESD). The material of the container or any other device used to carry ICs should be free from ESD, which can be caused by vibration during transportation. Use of electrically conductive containers is recommended as an effective countermeasure.
  - (b) Everything that touches ICs, such as the work platform, machine, measuring equipment, and test equipment, should be grounded.
  - (c) Workers should be high-impedance grounded (100k $\Omega$  to 1M $\Omega$ ) while working with ICs, to avoid damaging the ICs by ESD.
  - (d) Friction with other materials, such as high polymers, should be avoided.
  - (e) When carrying a PCB with a mounted IC, ensure that the electric potential is maintained at a constant level using the short-circuit terminals and that there is no vibration or friction.
  - (f) The humidity at an assembly line where ICs are mounted on circuit boards should be kept around 45 to 75 percent using humidifiers or such. If the humidity cannot be controlled effectively, using ionized air blowers (ionizers) is effective.
- 6.2 Storage Conditions (applied to: ECN30624F, ECN30624R, ECN30625F, ECN30625R, ECN30625S)
  - (1) Before opening the moisture prevention bag (aluminum laminate bag)

Temperature: less than 40°C Humidity: less than 90%RH Period: less than 12 months

(2) After opening the moisture prevention bag (aluminum laminate bag)

Temperature: 5°C to 30°C Humidity: less than 60%RH Period: less than 168 hours

When the period of (1) and (2) is likely to expire, store ICs in a drying furnace (10%RH or lower) at ordinary temperature.

## (3) Baking process

When the period of (1) and (2) has expired, ICs should be baked in accordance with the following conditions. (However, when ICs are stored in a drying furnace (10%RH or lower) at ordinary temperature, there is no need to bake.)

Do not bake the tape and the reel of the taping package because they are not heat resistant.

Transfer ICs to a heat resistant container prior to baking.

Temperature: 125°C to 135°C Period: more than 48 hours

## 6.3 Maximum Ratings

Regardless of changes in external conditions during use of our IC, the "maximum ratings" should never be exceeded when designing electronic circuits that employ our IC. If maximum ratings are exceeded, our IC may be damaged or destroyed. In no event shall our company be liable for any failure in our IC or any secondary damage resulting from use at a value exceeding the maximum ratings.

#### 6.4 Derating Design

Continuous high-load operation (high temperatures, high voltages, large currents) should be avoided and derating design should be applied, even within the ranges of the maximum ratings, to ensure reliability.

#### 6.5 Safe Design

Our IC may fail due to accidents or unexpected surge voltages. Accordingly, adopt safe design features, such as redundancy and measures to prevent misuse, in order to avoid extensive damage in the event of a failure.

## 6.6 Application

If our IC is applied to the following uses where high reliability is required, obtain the document of permission from our company in advance.

· Automobile, Train, Vessel, etc.

Do not apply our IC to the following uses where extremely high reliability is required.

• Nuclear power control system, Aerospace instrument, Life-support-related medical equipment, etc.

#### 7. Notes Regarding this Document

- (1) All information included in this document such as product data, diagrams, charts, algorithms, and application circuit examples, is current as of the date this document is issued. Such information, specifications of products, etc. are subject to change without prior notice. Before purchasing or using any of our products listed in this document, please confirm the latest product information with our sales office.
- (2) Our company shall not be held liable in any way for damages and infringement of patent rights, copyright or other intellectual property rights arising from or related to the use of the information, products, and circuits in this document.
- (3) No license is granted by this document of any patents, copyright or other intellectual property rights of any third party or of our company.
- (4) This document may not be reprinted, reproduced or duplicated, in any form, in whole or in part without the express written permission of our company.
- (5) You shall not use our products (technologies) described in this document and any other products (technologies) manufactured or developed by using them (hereinafter called "END Products") or supply our products (technologies) and END Products for the purpose of disturbing international peace and safety, including ( i ) the design, development, production, stockpiling or any use of weapons of mass destruction such as nuclear, chemical or biological weapons or missiles, ( ii ) the other military activities, or (iii) any use supporting these activities. You shall not sell, export, dispose of, license, rent, transfer, disclose or otherwise provide our products (technologies) and END Products to any third party whether directly or indirectly with knowledge or reason to know that the third party or any other party will engage in the activities described above.
  - When exporting, re-export transshipping or otherwise transferring our products (technologies) and END Products, all necessary procedures are to be taken in accordance with Foreign Exchange and Foreign Trade Act (Foreign Exchange Act) of Japan, Export Administration Regulations (EAR) of US, and any other applicable export control laws and regulations promulgated and administered by the governments of the countries asserting jurisdictions over the parties or transaction.
- (6) Our company has taken reasonable care in compiling the information included in this document, but our company assumes no liability whatsoever for any damage incurred as a result of errors or omissions in the information included in this document.
- (7) Please contact our sales office if you have any questions regarding the information in this document or any other inquiries.